

SB, Gearbox locking pin, FS5000, FS7000, 3-speed gearbox, 2025-03

SYMPTOM/DESCRIPTION


The locking pin with counter nut on the 3-speed gearbox must not be overtightened, there is a risk that over time and together with vibrations, the screw will break. The correct procedure when securing the selected gear is to tighten the locking pin finger-tight and then tighten the counter nut with a tool and the lowest possible torque. This must not supersede 50Nm.

AFFECTED UNITS


FS 5000D and 7000 D/DL with a 3-speed gearbox.

PARTS INFORMATION

Parts name	Old part no.	Model
Locking pin	586917201	FS5000D
Locking pin	586917202	FS7000 D/DL
Flange nut	731712451	FS5000D/7000D/DL

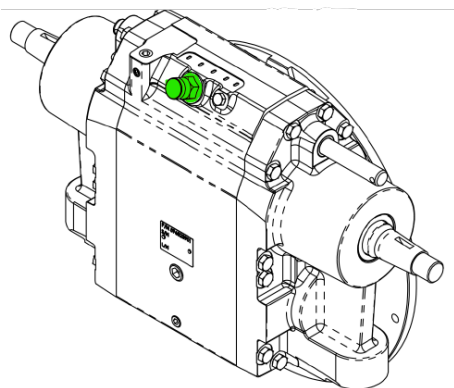

FS7000D/DL

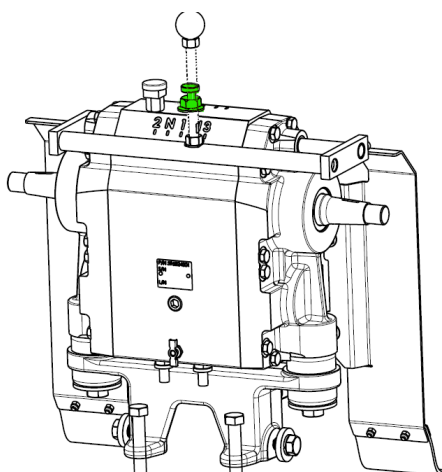

FS5000D

Revision History

Rev.	Date	Order id.	Description
A	2025-03	00141820	Created